Potentiometer Input to DC Transmitters, Isolated, Field Rangeable

Input: **100** Ω to 1 M Ω Potentiometers

Output: 0-1 V to ±10 VDC, or 0-2 mA to 0-20 mADC

- Accepts Wide Range of Potentiometers
- Set-up via External Rotary Switches
- Easy-to-use Setup Tables •
- Selectable Voltage or Current Outputs
- 2000 VRMS Isolation Input/Output/Power
- Input and Output LoopTracker® LEDs
- Functional Test Button

Applications

- Over, Under, Out-of-Range Position Monitoring
- Remote Control of Positioning Devices
- Simplify Control of Potentiometer Outputs

Potentiometer Input Ranges

Full travel of potentiometer and 3 wire connection required Minimum: 0-100 Q

Maximum: 0-1 MΩ Consult factory for other ranges and configurations Input Impedance

10 MO minimum

Common Mode Rejection

100 dB minimum LoopTracker

Variable brightness LEDs indicate I/O level and status

DC Output Ranges

Field selectable ranges via switch settings See table on other side for complete listing or consult factory for special ranges

Voltage:

0-1 VDC to 0-10 VDC, 10 mA max Bipolar voltage: ±5 VDC or ±10 VDC

Current: 0-2 mADC to 0-20 mADC

20 V compliance, 1000 Ω at 20 mA **Output Logic**

Normal (standard) or reverse acting with M01 option

Calibration

Multi-turn zero and span potentiometers for output ±15% of span adjustment range typical

Output Ripple and Noise

Less than 10 mVRMS

Output Loop Power Supply

20 VDC nominal, regulated, 25 mADC, max. ripple <10 mVRMs **Output Test**

Front button sets output to test level when pressed Potentiometer adjustable 0-100% of span

Accuracy

±0.1% of span (includes adjustment resolution and linearity) Better than 0.02% of span per °C temperature stability

Response Time

70 milliseconds typical

Isolation

2000 VBMS minimum


Full isolation: power to input, power to output, input to output

Installation Environment

IP 40, requires installation in panel or enclosure Use with API 008 or API 008 FS socket Socket mounts to 35 mm DIN rail or can be surface mounted UL 508C pollution degree 2 environments or better -10°C to +60°C operating ambient

Power

Standard:	115 VAC ±10%, 50/60 Hz, 2.5 W max.
P option:	85-265 VAC 50/60 Hz, 60-300 VDC, 2.5 W
A230 option:	230 VAC ±10%, 50/60 Hz, 2.5 W max.
D option:	9-30 VDC, 2.5 W typical

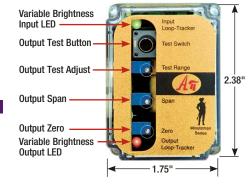

IFÉTIME

MADE IN USA

Free Factor

I/O Setup!

VARRANT



Plug-In Design



115 VAC. 230 VAC models



Description

The API 4008 G accepts a resistance input from potentiometer, slidewire, linear position, displacement, or rotational devices and provides an optically isolated DC voltage or current output that is linearly related to the potentiometer position.

The API 4008 G will accept any potentiometer with a value of 0-100 Ω through 0-1 M Ω without recalibration and without affecting accuracy as long as 100% of the potentiometer range is used. Models with offsets and/or input ranges other than 0 to 100% of the pot are available. Consult factory for assistance.

The API 4008 G output can be field-configured via external rotary and slide switches. 10 DC voltage or 8 DC current ranges can be selected from the table on the module. Other output ranges are available.

The full 3-way (input, output, power) isolation makes this module useful for ground loop elimination, common mode signal rejection or noise pickup reduction.

Output Loop Power Supply

The API 4008 G has an 20 VDC loop excitation supply for the output. This power supply can be used to power a passive mA device.

LoopTracker

API exclusive features include two LoopTracker LEDs (green for input, red for output) that vary in intensity with changes in the process input and output signals. These provide a quick visual picture of your process loop at all times and can greatly aid in saving time during initial startup and/or troubleshooting.

Output Test

An API exclusive feature includes the test button to provide a fixed output (independent of the input) when held depressed. The test output level is potentiometer adjustable from 0 to 100% of output span.

The output test button greatly aids in saving time during initial startup and/or troubleshooting.

Model	Input	Output	Power
API 4008 G	Any full-range potentiometer from 0-100 Ω to 0-1 M Ω Specify if custom range is required	Field configurable specify range if factory is to set switches	115 VAC C Us
API 4008 G A230			230 VAC C 🕄 us
API 4008 G P			85-265 VAC or 60-300 VDC
API 4008 G D	Specify in custom range is required	Switches	9-30 VDC

Options-add to end of model number

- M01 Input/output reversal, such as 4-20 mA input to 20-4 mA output П
 - Conformal coating for moisture resistance

Accessories-order as separate line item

- API 008 8-pin socket
- API 008 FS 8-pin finger-safe socket
- API CLP1 Module hold-down spring for high vibration or mobile applications





300 V Rating

600 V Rating

© 08-15



API 4008 G

1220 American Way Libertyville, IL 60048 Phone: 800-942-0315 Fax: 800-949-7502

api-usa.com


LBSOLUTE **PROCESS i**NSTRUMENTS, Inc.

Installation and Setup

Range Selection

See model/serial number label for any applicable options or custom ranges. Select ranges before installation.

See table below for module output range settings. From the table, find the switch setting that matches your output range. Make sure to set the V—I switch for voltage or current output respectively.

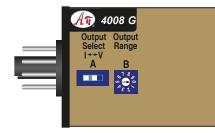

Voltage Output	AB	Current Output	AB
0-1 VDC	V O	0-2 mA	ΙO
0-2 VDC	V 8	0-4 mA	I 8
0-4 VDC	V 1	0-8 mA	I 1
0-5 VDC	V 9	0-10 mA	I 9
0-8 VDC	V 2	0-16 mA	I 2
0-10 VDC	V 3	0-20 mA	I 3
1-5 VDC	V 6	2-10 mA	I 6
2-10 VDC	V 7	4-20 mA	I 7
±5 VDC	V 4		
±10 VDC	ν 5		

Precautions

WARNING! All wiring must be performed by a qualified electrician or instrumentation engineer. See diagram for terminal designations and wiring examples. Consult factory for assistance. WARNING! Avoid shock hazards! Turn signal input, output, and power off before connecting or disconnecting wiring, or removing or installing module.

Précautions

ATTENTION! Tout le câblage doit être effectué par un électricien ou ingénieur en instrumentation qualifié. Voir le diagramme pour désignations des bornes et des exemples de câblage. Consulter l'usine pour assistance.

ATTENTION! Éviter les risques de choc! Fermez le signal d'entrée, le signal de sortie et l'alimentation électrique avant de connecter ou de déconnecter le câblage, ou de retirer ou d'installer le module.

Socket and Mounting

The module installation requires a protective panel or enclosure. Use API 008 or finger-safe API 008 FS socket.

The socket clips to a standard 35 mm DIN rail or can be attached to a flat surface using the two mounting holes.

Electrical Connections

See model/serial number label for module power requirements, and any applicable options or custom ranges.

Polarity must be observed for input and out output wiring connections. If the output does not function, check switch settings and wiring polarity.

Signal Input Terminals

The potentiometer must be connected to all three signal input terminals as shown. 0-100% of the potentiometer range must be used. The API 4008 G utilizes a stable 1 VDC source to excite the potentiometer.

Potentiometer Input	Terminal
Zero or low end of potentiometer	4
Potentiometer wiper arm	5
Full scale or high side of potentiometer	6 (+1 VDC)

Signal Output Terminals

Polarity must be observed when connecting the signal output to the load. The positive connection (+) is connected to terminal 7 and the negative (-) is connected to terminal 8.

Note that with a mA current output the module provides power to the output loop.

For ranges that fall between the listed ranges use the next highest setting and trim the output signal with the zero and span potentiometers.

Module Power

Check model/serial number label for module operating voltage to make sure it matches available power.

AC power is connected to terminals 1 and 3.

For DC powered modules, polarity MUST be observed. Positive (+) is wired to terminal 1

Negative (-) is wired to terminal 3

Calibration

After the API 4008 G range switches are set, and the module is installed and powered, top-mounted Zero and Span potentiometers are available to fine-tune the module output.

- 1. Apply power to the module and allow a minimum 20 minute warm up time.
- Set the input potentiometer to its minimum value to provide a minimum input to the module.
- 3. Connect an accurate measurement device to the module output. Adjust the module's Zero potentiometer for the exact minimum output desired. The Zero control should only be adjusted when the input signal is at its minimum to produce the corresponding minimum output signal. Example: for a 4-20 mA output signal, the Zero control will allow adjustment of the 4 mA or low end of the signal.
- 4. Set the input potentiometer at its maximum, and then adjust the module's Span pot for the exact maximum output desired. The Span control should only be adjusted when the input signal is at its maximum. This will produce the corresponding maximum output signal. Example: for 4-20 mA output signal, the Span control will provide adjustment for the 20 mA or high end of the signal.
- 5. Repeat adjustments for maximum accuracy.

Output Test Function

The Test button may be pushed to provide a fixed output when depressed. This will drive the device on the output side of the loop (a panel meter, chart recorder, etc.) with a known good signal that can be used as a system diagnostic aid during initial start-up or during troubleshooting.

It can be adjusted to vary the output signal from 0 to 100% of the calibrated output range. When released, the output will return to normal.

Turn the multi-turn Test Range potentiometer while holding the Test Switch depressed until the desired output test level is reached.

Operation

The API 4008 G utilizes a stable 1 VDC source to excite the potentiometer. This voltage is stabilized against the potentiometer resistance value variations over the entire operating range.


The resulting potentiometer wiper voltage is amplified and passed through an optical coupler to the output stage where it is scaled to the desired output range.

The green LoopTracker[®] input LED provides a visual indication that a signal is being sensed by the input circuitry of the module. It also indicates the input signal strength by changing in intensity as the process changes from minimum to maximum.


If the LED fails to illuminate, or fails to change in intensity as the process changes, check the module power or signal input wiring. Note that it may be difficult to see the LEDs under bright lighting conditions.

The red LoopTracker output LED provides a visual indication that the output signal is functioning. It becomes brighter as the input and the corresponding output change from minimum to maximum.


For current outputs, the red LED will only light if the output loop current path is complete. For either current or voltage outputs, failure to illuminate or a failure to change in intensity as the process changes may indicate a problem with the module power or signal output wiring.

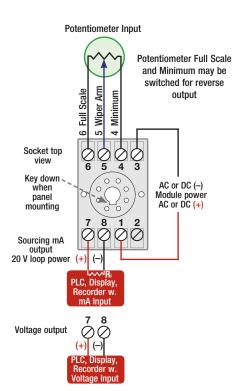

API 4008 G

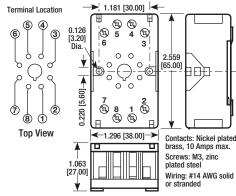

API 008 FS 8-Pin Finger Safe Socket

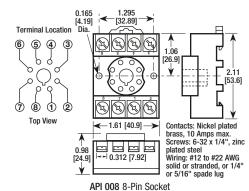

API maintains a constant effort to upgrade and improve its products. Specifications are subject to change without notice. Contact factory for assistance and see api-usa.com for latest datasheet version.

BSOLUTE PROCESS INSTRUMENTS, Inc.

1220 American Way Libertyville, IL 60048 Phone: **800-942-0315** Fax: 800-949-7502